






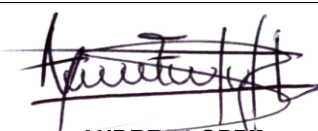


**COMMERCIAL - TECHNICAL DATA / Tecnologia**

**STOLICHNAYA**

100% LINEN

| Test Method for Woven Fabrics   |                     | STANDAR (estandar) | DIGITAL PRINT  |
|---|---------------------|--------------------|--|
| Width / Ancho (In)<br>NTC 228-2011  | Phisic / Físico     | 51                 | 51   |
|   | Useful / Util       | 50                 | 49   |
| Weight / Peso (Oz/syd)<br>ASTM D 3776-2009  |                     | 6.2                | 6.3  |
| Shrinkage / Cambio dimensional (%)<br>AATCC 135-2004 / IN504-15   | Lenght / Longitud   | 8%                 | 8%   |
|   | Trans / Transversal | 6%                 | 6%   |
| Spirality after laundry / Viraje despues del lavado (%)<br>ISO16322-2-2005  | Lenght / Longitud   | 3%                 | 3%   |
|   | Trans / Transversal |                    |  |
| Color fastness to wash / Solidez al lavado (gray scale)<br>AATCC 61-2007  | Change / Cambio     | 4                  | 4  |
|   | Stain / Transf      | 3                  | 3  |
| Dye transfer to storage. Option II (gray scale) / Transferencia del color por almacenamiento. Opcion II<br>AATCC 163-2007   | Stain / Transf      | 4                  | 4  |
| Color fastness to light (gray scale) / Solidez a la luz<br>BS 1006-1990   | Change / Cambio     | 4                  | 4  |
| Color fastness to crocking (gray scale) / Solidez al frote<br>AATCC 8-2007  | Dry / Seco          | 4                  | 4  |
|   | Wet / Húmedo        | 3                  | 3  |
| Color Fastness to perspiration (gray scale) / Solidez a la transpiración<br>AATCC 15-2007   | Change / Cambio     | 4                  | 4  |
|   | Stain / Transf      | 3                  | 3  |
| Pilling / Pilling (Photographic)<br>NTC 2051-2 / 2003   |                     | 3                  | 3  |
| Type of fabric / Tipo de tejido   |                     |                    | Woven  |
|   |                     |                    | <b>Reviewed by</b>   |
| <b>Recommendations:</b><br>Rest for 20 to 24 hours before cutting.<br>Make prior tests of fusion or dyeing if is required.<br>High shrinkage fabric.  |                     |                    | <br><b>ANDRES LOPEZ</b> |
|      |                     |                    |  |